"ZERO" or "TARE" Function

To weigh different loads consecutively without removing loads from the scale.
1. Put first load on the scale, get weight reading.
2. Press ZERO button to reset the LCD reading to "0" before adding next load.
You can repeat this operation.

Condition 1: "ZERO" function
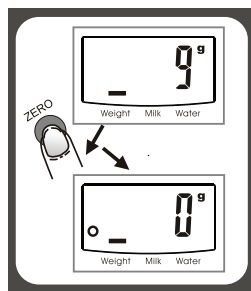**When total sum of all loads on scale is less than or equal to 200g.**

LCD will show "-----" or "0g" each time ZERO is pressed. "-----" means not stable, please wait for a moment. "0g" and an icon "o" on lower left corner of LCD means "ZERO" function is active. Max. weight capacity remains unchanged.
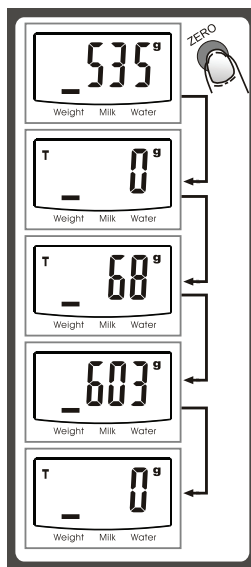
Condition 2: "TARE" function
When total sum of all loads on scale is greater than 200g.

LCD will show "-----" or "0g" each time ZERO is pressed. "-----" means not stable, please wait for a moment. "0g" and an icon "TARE" on upper left corner of LCD means "TARE" function is active. Max. weight capacity is reduced by total weight of all loads.

Under this condition, by pressing ZERO, you can see the total weight of all loads on the scale. If you want to weigh more loads, just press ZERO to reset LCD reading to "0" again.
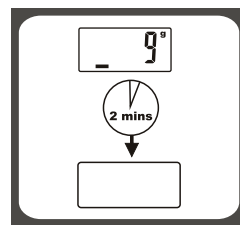
Condition 1

Condition 2

Auto Shut Off

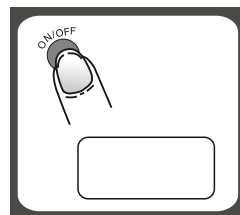Auto shut-off occurs if display shows "0" or shows the same weight reading for 2 minutes.

Manual Shut Off

To maximize battery life, always press ON/OFF again to turn off the scale after using.
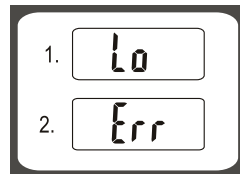
Note:
• When display shows "0", press "ON/OFF" to turn off the scale.
• When display shows weight reading, press "ON/OFF" for 3 seconds to turn off the scale.

Warning Indicators

1. Replace new battery.
2. Scale overload. Remove item to avoid damage. Max. weight capacity is indicated on the scale.
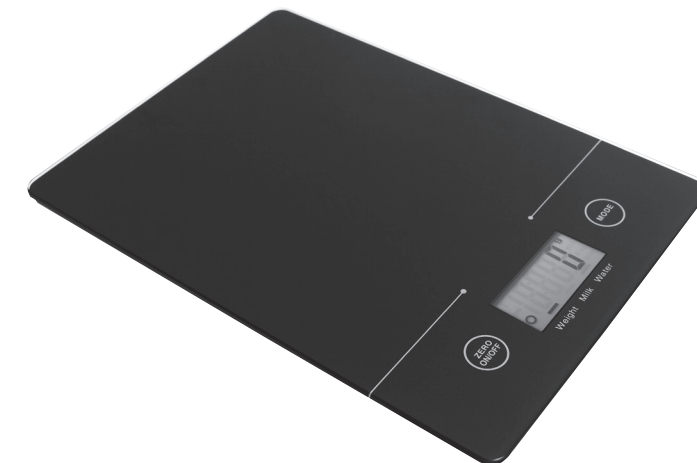
1. Lo
2. Err

Cleaning and Care

1. Clean the scale with a slightly damp cloth. DO NOT immerse the scale in water or use chemical/abrasive cleaning agents.
2. All plastic parts should be cleaned immediately after contact with fats, spices, vinegar and strongly flavored/colored foods. Avoid contact with acidic citrus juices.
3. Always use the scale on a hard, flat surface. DO NOT use on carpet.

ForPro Professional Collection®

Digital All-Purpose Scale

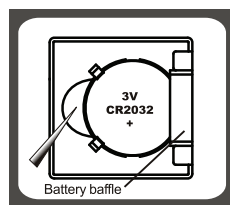**IMPORTANT INSTRUCTIONS — RETAIN FOR FUTURE USE**

Congratulations on your purchase of the **ForPro Digital All-Purpose Scale.** Please read the instructions before use. Your scale comes with a one-year limited warranty. If for any reason you need service, please call 800-520-6000.
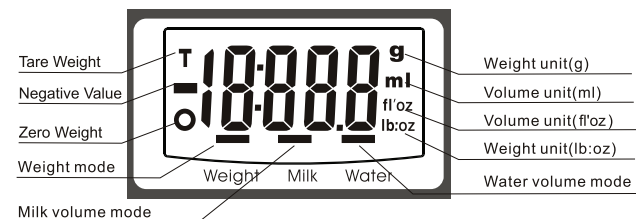
Features

• Indicates volume of water and milk
• Two weight unit systems g, lb.:oz. convertible
• Two volume unit systems ml, fl. oz. convertible
• Low battery power/Overload indication
• High precision strain gauge sensor
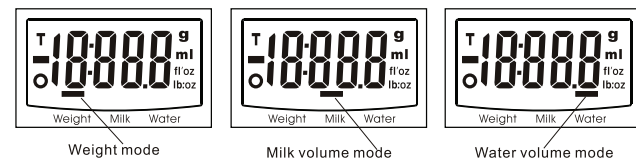• Tare function
• Auto off

To Install or Replace Battery

The scale uses 1 x 3V CR2032 lithium battery (included).
1. Remove isolation sheet before first use.
2. Open the battery case cover at the bottom of the scale.
3. Take out the used battery with the aid of a sharp object, as shown in picture.
4. Install new battery by putting one side of the battery beneath the battery baffle and then press down the other side.
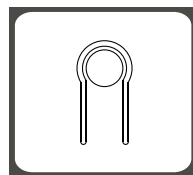
3V
CR2032
+

Battery baffle

LCD Display

Tare Weight
Negative Value
Zero Weight
Weight mode
Milk volume mode

Weight unit(g)
Volume unit(ml)
Volume unit(fl'oz)
Weight unit(lb:oz)
Water volume mode

Weight   Milk   Water

Working Modes

Weight mode   Milk volume mode   Water volume mode
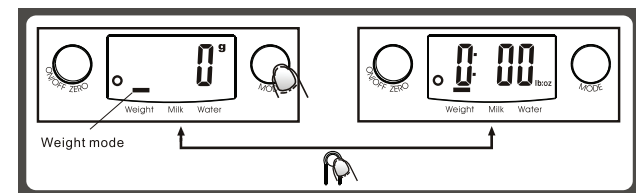
Weight   Milk   Water

Unit Conversion Button

At the bottom of scale, you can find a unit conversion button as shown in picture.

To Convert Weight Unit

The scale has both unit systems of Metric (g, ml) and Imperial (lb.:oz., fl. oz.). Press MODE button to choose working mode (weight, milk volume, water volume), then press unit conversion button to convert between two systems. Take the conversion of weight unit for example:
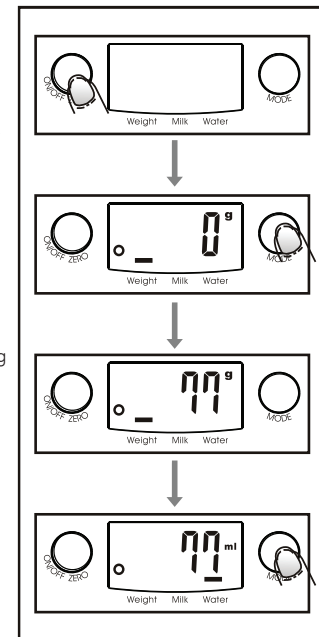
Weight mode

Weight   Milk   Water

• When setting g as weight unit, the default volume unit is ml.
• When setting lb.:oz. as weight unit, the default volume unit is fl. oz.

To Start Weighing

Weighing mode
1. Place the scale on a solid and flat surface.
2. Place bowl (if used) on the scale before turning on the scale.
3. Press "ON/OFF" to enter weighing mode.
4. Wait until LCD shows all information.
5. Load weighing object in to start weighing. LCD will show the weight reading.
6. If the weighing object is water or milk, press MODE button to choose volume mode and view the volume of weighing object.

Weight   Milk   Water

Volume indication mode
1. Place the scale on a solid and flat surface.
2. Press "ON/OFF" to turn on the scale.
3. Wait until LCD shows "0", and press MODE button to choose "Water" or "Milk" mode.
4. Put a liquid container onto the scale platform.
5. Press ZERO button to reset LCD to "0".
6. Pour liquid (water or milk) into the container. LCD shows the volume of the liquid.
7. Press MODE button to choose "Weight" mode and view the weight of liquid.

Weight   Milk   Water